

Fig1

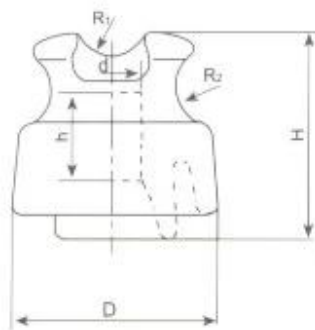


Fig2

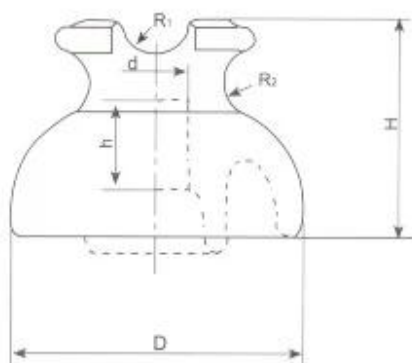


Fig3

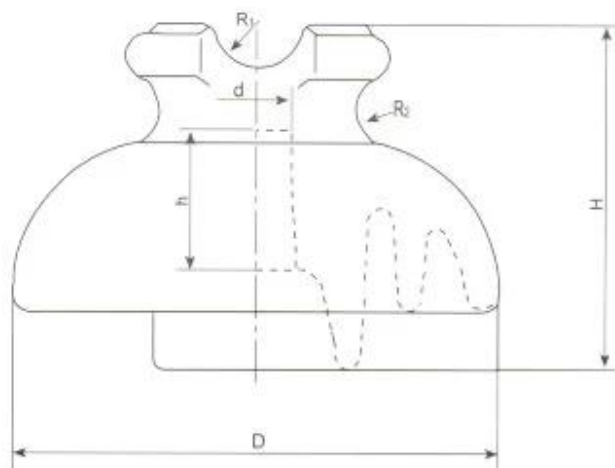


Fig4

DINENSTIONS 1111111 1111111111 1111111111

Cat.No. 1111 ANSI	1111 1111	111111	1111111111 1111111111					11111111 11111111 11111111 11111111		1111 :11111111 1111	1111111111 11111111 1111 :11111111 1111
			H	11	11	11	R1	R2	11		
M10K01 (55-1)	111111	1	3 1/2	1 3/4	3 1/4	1		1/2	4	4	2 1/4
M10K02 (55-1)	11 111111	1	3 1/2	1 3/4	3 1/4	1		1/2	4	4	2 1/4
M10K03 (55-2)	111111	2	3 1/4	1 1/2	3 3/4	1	5/8	5/8	4	5	3 3/8
M10K04 (55-2)	11 111111	2	3 1/4	1 1/2	3 3/4	1	5/8	5/8	4	5	3 3/8
M10K05 (55-3)	111111	3	3 3/4	1 1/2	4 3/4	1	16/09	16/09	5	7	4 1/2
M10K06 (55-3)	11 111111	3	4 3/8	1 1/2	4 3/4	1	16/09	16/09	5	7	4 1/2
M10K07 (55-4)	111111	4	4 3/8	1 3/4	5 1/2	1	1	16/09	5	9	5
M10K08 (55-4)	11 111111	4	4 7/8	1 3/4	5 1/2	1	1	16/09	5	9	5
M10K09 (55-5)	111111	4	4 7/8	2	7	1	1	16/09	6	12	6 1/4
M10K10 (55-5)	11 111111	4	5 1/2	2	7	1	1	16/09	6	12	6 1/4
M10K11 (55-6)	111111	4	5 1/2	2 1/4	8 3/8	1	1	5/8	7 1/2	15	8
M10K12 (55-6)	11 111111	4	5 1/2	2 1/4	8 3/8	1	1	5/8	7 1/2	15	8
M10K13 (55-7)	111111	4	5 1/2	2 1/4	8 3/8	1 3/8	1	5/8	7 1/2	15	8

M10K14 (55-7)	100 100000	4	5 _{1/2}	2 _{1/4}	8 _{3/8}	1 _{3/8}	1	5/8	7 1/2	15	8
------------------	------------	---	------------------	------------------	------------------	------------------	---	-----	-------	----	---

Cat.No. ANSI	100000 1000000 100000 10000 10000			100000 100000 100000 flashover 10000 10000		1000000 1000000 100000		1000 100000000 10000.	1000000 100 1000
	1000 10000	10000 10000	1000	1000000	1000	10000 1000000 100000 100000 100000 1000 10000 10000	10000 RIV 10000 1000kc 1000 10000 1000		
M10K01 (55-1)	35	20	50	50	70	5	2500	3000	P-3-M
M10K02 (55-1)	35	20	50	50	70	5	50	3000	P-3-M
M10K03 (55-2)	50	25	70	75	95	5	2500	2500	P-6-M
M10K04 (55-2)	45	25	70	70	85	5	20	2500	1-6 1
M10K05 (55-3)	65	35	90	100	130	10	5500	2500	P ₂ -10-M
M10K06 (55-3)	55	30	90	90	110	10	50	2500	P ₂ -10-M
M10K07 (55-4)	70	40	95	110	140	10	5500	3000	P-10-M
M10K08 (55-4)	65	35	95	105	130	10	50	3000	P-10-M
M10K09 (55-5)	85	45	115	140	170	15	8000	3000	P-15-M
M10K10 (55-5)	80	45	115	130	150	15	100	3000	P-15-M
M10K11 (55-6)	100	50	135	150	170	22	8000	3000	P-22-M
M10K12 (55-6)			135			22	100	3000	P-22-M
M10K13 (55-7)	100	50	135	150	170	22	8000	3000	P ₁ -22-M
M10K14 (55-7)			135			22	100	3000	P ₁ -22-M